

CLASSIFIED MESSAGE

DATE : 0948Z 25 AUG 61

SECRET

ROUTING

| | |
|---|---|
| 1 | 4 |
| 2 | 5 |
| 3 | 6 |

PRIORITY

PRIORITY

IN 15973

TO : DIRECTOR

FROM :

ACTION: DPD (1-2-3-4-5-6-7-8-9-10)

INFO : S/C (11)

KEN

TOR: 0948Z 25 AUGUST 1961

TO PRITY

INFO

CITE

054

REF: 044 (IN 15676)

1921 (IN 15799)

1. SHUTOFF VALVES AND FLOATS HAVE BEEN REMOVED FROM ARTICLE 358 AND VISUALLY INSPECTED. THEY MOVE FREELY WITHOUT ANY BINDING AND LOOK TO BE OK. GROUND CHECKS PRIOR TO REMOVAL WITH ENGINE RUNNING PROVES THAT SUMP TANK IS BEING REFILLED AT A RAPID RATE WHICH FURTHER INDICATES THAT BOTH VALVES ARE FUNCTIONING PROPERLY.

2. SHUTOFF VALVES, FLOATS AND SWITCHES SHIPPED FROM [] HAVE NOT ARRIVED. PROPOSE TO REMOVE OUTBOARD VENT TUBES REINSTALL SHUTOFFS, FLOATS AND SWITCHES. WILL CLIMB TO ALTITUDE TWICE ON TEST HOP AND DESCEND TO THOROUGHLY CHECK LOW LEVEL FLIGHT.

3. SINCE VALVES ARE KNOWN TO BE WORKING PROPERLY DURING CLIMB OUT AND PERIODS OF HIGH FUEL CONSUMPTION STRONGLY SUSPECT THAT PROBLEM IN THIS CASE WAS CAUSED BY ICE BLOCKING THE OUTBOARD

SECRET

S E C R E T

25X1A

054 (IN 15973)

PAGE TWO

VENT TUBE.

4. IF TEST HOP IS SUCCESSFUL AND LOW LEVEL LIGHT DOES NOT ILLUMINATE WOULD THEN CONSIDER ARTICLE IN COMMISSION.

25X1A

5. THE ONLY OTHER ALTERNATIVE IS FOR TO RESHIP THE PARTS IMMEDIATELY BY COURIER.

25X1A

6. REQUEST COMMENT FROM HDQS AND .

END OF MESSAGE

S E C R E T